

AD-A138 014

UH-60 SHOULDER HARNESS LEAD-IN STRAP FAILURE ANALYSIS  
(U) ARMY AEROMEDICAL RESEARCH LAB FORT RUCKER AL  
T A HUNDLEY OCT 83 USAARL-84-1


1/1

UNCLASSIFIED

F/G 1/3

NL



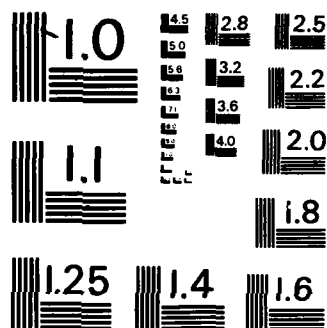

MICROCOPY RESOLUTION TEST CHART  
NATIONAL BUREAU OF STANDARDS - 1963-A

12

USAARL REPORT NO. 84-1

**UH-60 SHOULDER HARNESS LEAD-IN  
STRAP FAILURE ANALYSIS**

By  
**Ted A. Hundley**


**DTIC**  
**ELECTE**  
FEB 21 1984  
A

**BIODYNAMICS RESEARCH DIVISION**

**October 1983**

**U.S. ARMY AEROMEDICAL RESEARCH LABORATORY  
FORT RUCKER, ALABAMA 36362**

AD A138014

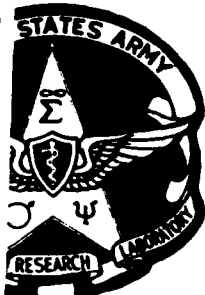

DTIC FILE COPY

**USAARL**

## NOTICE

### Qualified Requesters

Qualified requesters may obtain copies from the Defense Technical Information Center (DTIC), Cameron Station, Alexandria, Virginia. Orders will be expedited if placed through the librarian or other person designated to request documents from DTIC.

### Change of Address

Organizations receiving reports from the US Army Aeromedical Research Laboratory on automatic mailing lists should confirm correct address when corresponding about laboratory reports.


### Disposition

Destroy this report when it is no longer needed. Do not return it to the originator.


### Disclaimer

The views, opinions, and/or findings contained in this report are those of the authors and should not be construed as an official Department of the Army position, policy, or decision, unless so designated by other official documentation. Citation of trade names in this report does not constitute an official Department of the Army endorsement or approval of the use of such commercial items.

Reviewed:

  
AARON W. SCHOPPER, Ph.D.  
LTC, MSC  
Director, Biodynamics Research  
Division

Released for Publication:

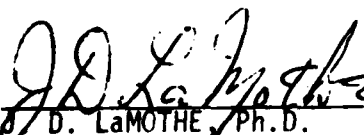  
D. LaMOTHE, Ph.D.  
LTC, MS  
Chairman, Scientific Review  
Committee

  
DUDLEY R. PRICE  
Colonel, MC, SFS  
Commanding

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER USAARL Report No. 84-1	2. GOVT ACCESSION NO. <i>A138014</i>	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) UH-60 Shoulder Harness Lead-In Strap Failure Analysis		5. TYPE OF REPORT & PERIOD COVERED
		6. PERFORMING ORG. REPORT NUMBER
7. AUTHOR(s)  Ted A. Hundley		8. CONTRACT OR GRANT NUMBER(s)
9. PERFORMING ORGANIZATION NAME AND ADDRESS SGRD-UAD-IV US Army Aeromedical Research Laboratory Fort Rucker, Alabama 36362		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS 62777A 3E162777A878 AG 137
11. CONTROLLING OFFICE NAME AND ADDRESS  US Army Aeromedical Research Laboratory Fort Rucker, Alabama 36362		12. REPORT DATE October 1983
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)		13. NUMBER OF PAGES
		15. SECURITY CLASS. (of this report)  UNCLASSIFIED
15a. DECLASSIFICATION/DOWNGRADING SCHEDULE		
16. DISTRIBUTION STATEMENT (of this Report)  Approved for public release; distribution unlimited.		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
18. SUPPLEMENTARY NOTES		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number)  <div style="display: flex; justify-content: space-between;"> <div> Restraint Harness Failure  Shoulder Harness Failure  Blackhawk Accidents </div> <div> Webbing  Crashworthiness </div> </div>		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number)  See back of form.		

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE(When Data Entered)

20. ABSTRACT

Shoulder harness lead-in strap failures have occurred in several UH-60 Blackhawk helicopter accidents with crewmembers being injured as a result. An investigation into possible failure causes was conducted. The two most likely causes found were incorrect installation of the seat insert guide and an increase in stress in the lead-in strap caused by the radius of bend at the point where the strap passes through the seat back. Tests showed that incorrect installation of the seat insert guide caused a significant reduction in the failure load of the webbing. Tests also showed that a reduction in failure load occurred when the webbing was pulled over a radiused corner. The first problem was solved by removing and reinstalling the seat insert guides. The second problem can be dealt with by using a higher-strength lead-in strap.

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE(When Data Entered)

# TABLE OF CONTENTS

	PAGE NO.
List of Illustrations . . . . .	2
List of Tables. . . . .	2
Introduction. . . . .	3
Methods and Materials . . . . .	8
Results and Discussion. . . . .	9
Conclusions and Recommendations . . . . .	12
References Cited. . . . .	13
Appendix A - List of Manufacturers Cited. . . . .	14



Accession For	
DTIC Q5111	
DTIC TAB	
Unannounced	
Justification	
A-1	

## LIST OF ILLUSTRATIONS

FIGURE	PAGE NO.
1. Location of Blackhawk Seat Restraint System Components . . . .	3
2. Illustration of Correct and Incorrect Installation of Seat Insert Guide. . . . .	4
3. Webbing Test for Basic Tensile Strength Using Sedam Grips. . .	5
4. Test Fixture for Simulating Longitudinal Loading of Shoulder Harness Webbing Over Seat Insert Guide. . . . .	6
5. Test Fixture for Simulating Combined Lateral-Longitudinal Loading of Shoulder Harness Webbing Over Seat Insert Guide . .	7
6. Single Fiber Loop Efficiency for High Tenacity Polyester Fiber (Figure redrawn from bending limits of some high- modulus fibers, <i>Textile Research Journal</i> , Vol. 44, No. 12, Dec 1974, p. 972). . . . .	11

## LIST OF TABLES

TABLE	PAGE NO.
1. Webbing Failure Loads for Combined Lateral-Longitudinal Loading. . . . .	9



## INTRODUCTION

The U.S. Army's newest transport helicopter, the UH-60 Blackhawk, was designed to provide a significant amount of protection for aircraft occupants in case of a crash. However, in two separate crashes the shoulder harness lead-in strap on at least one of the pilot/copilot seats failed. In another crash, a failure of the lead-in strap occurred at the looped end where the shoulder harness straps attach (see Figure 1 for identification of items).

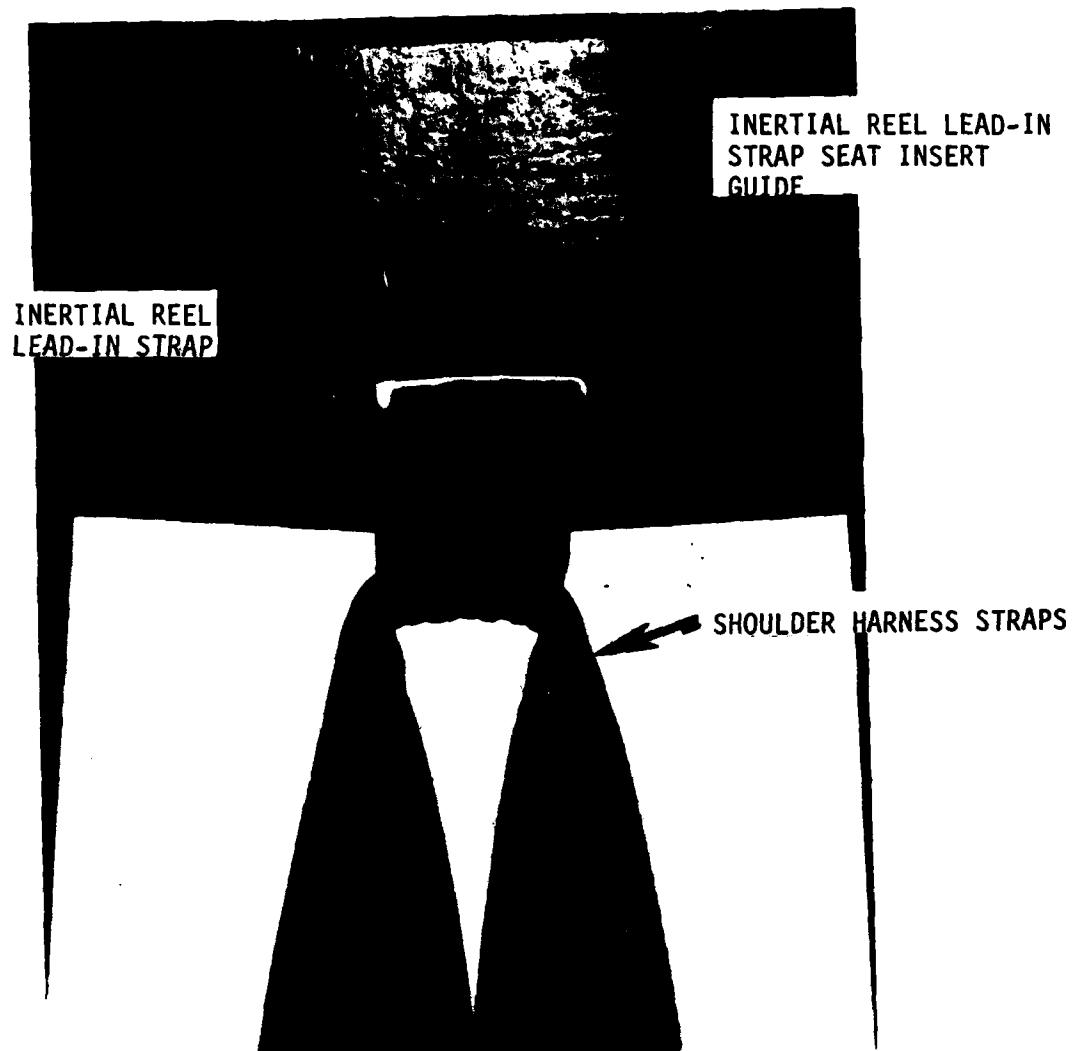


Figure 1. Location of Blackhawk Seat Restraint System Components.

Two potential causes for the failures were identified. The first was improperly installed lead-in strap seat insert guides. In the first two lead-in strap failures, the insert guides were installed reversed and upside down (Figure 2). In this orientation, the lead-in strap loads deformed the lower rear half of the guide and exposed a sharp edge to the strap. This may have caused a stress concentration or may have cut the strap resulting in a failure at a lower-than-designed load. The guides have since been removed and reinstalled correctly.

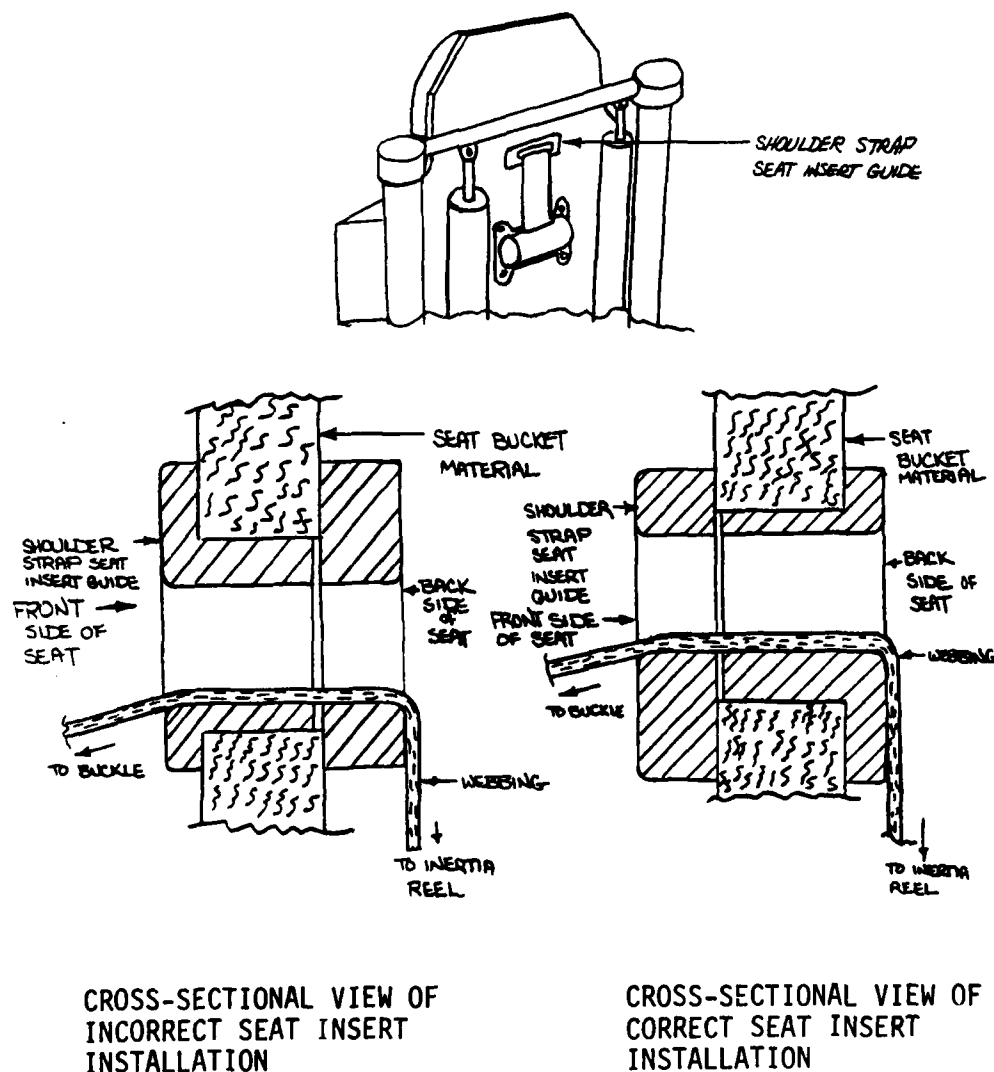


Figure 2. Illustration of Correct and Incorrect Installation of Seat Insert Guide.

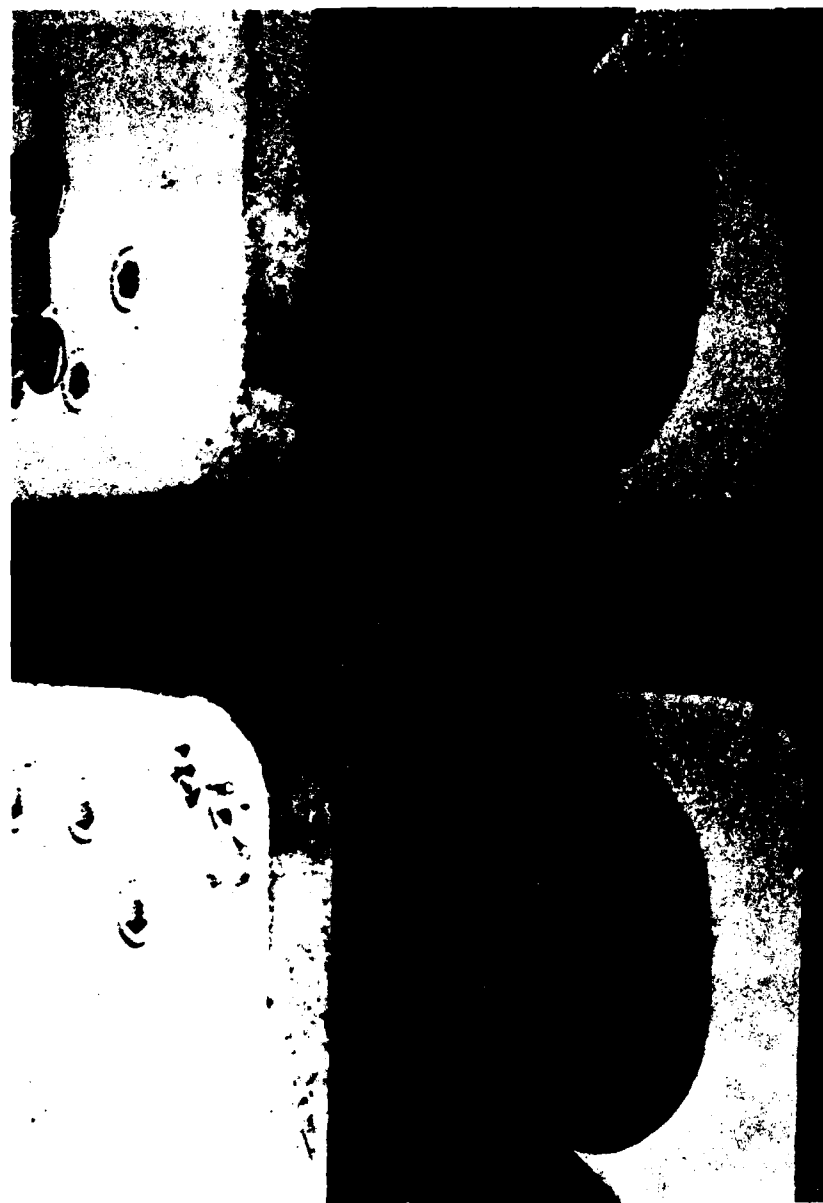


Figure 3. Webbing Test for Basic Tensile Strength Using Sedam Grips.

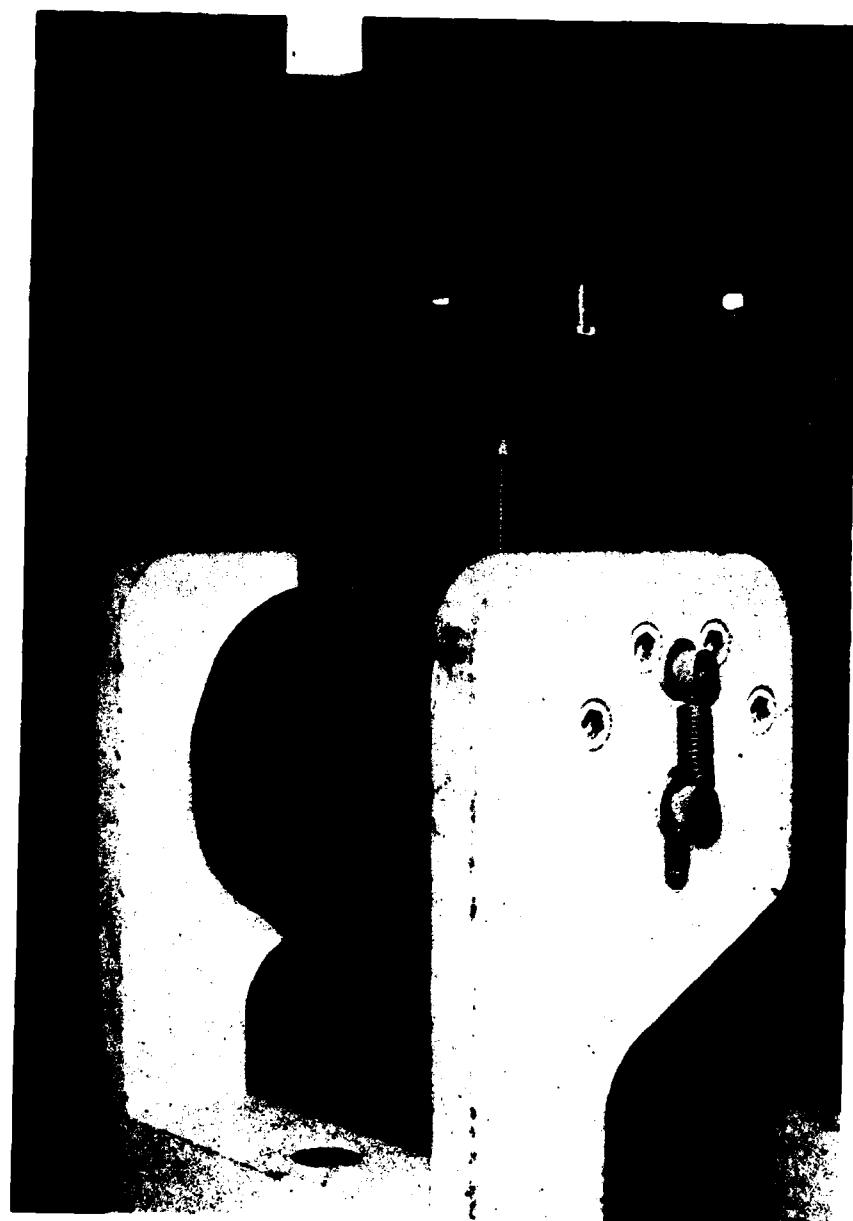


Figure 4. Test Fixture for Simulating Longitudinal Loading of Shoulder Harness Webbing Over Seat Insert Guide.

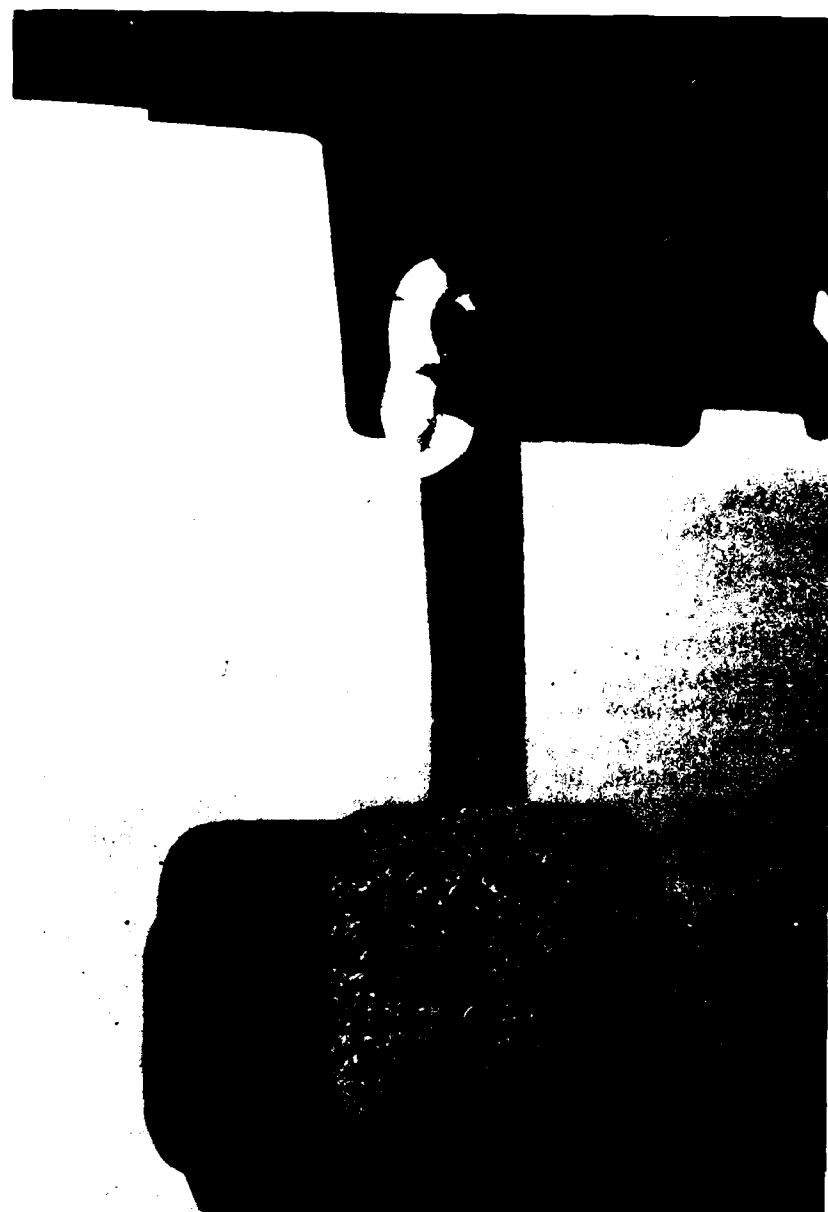


Figure 5. Test Fixture for Simulating Combined Lateral-Longitudinal Loading of Shoulder Harness Webbing Over Seat Insert Guide.

The other potential cause for failure is the stress concentration caused by the ninety-degree bend in the lead-in strap as it comes up the back of the seat from the inertia reel and goes through the seat insert guide to the seat occupant. The stress concentration is compounded by side loads which cause the webbing to bunch up at the side of the insert guide. In order to determine the failure loads for various combinations of strap material and loading geometry, independent test programs were conducted at Pacific Scientific Company, Anaheim, CA; Sikorsky Aircraft, Inc., Stratford, CT; and at the U.S. Army Aeromedical Research Laboratory (USAARL), Fort Rucker, AL.

## METHODS AND MATERIALS

The basic piece of apparatus employed was a Tinius-Olsen universal test machine. It is a low-speed material tester that provides tension or compression testing. Sedam grips were used to hold the webbing for the basic tensile strength test (Figure 3). Two test fixtures were fabricated to represent potential loading conditions in a crash. The first fixture represented a purely longitudinal load (Figure 4). The second fixture represented a combination of longitudinal load and lateral loading that resulted in a force vector inclined at a 60-degree angle from a line perpendicular to the front of the seat (Figure 5).

Two series of tests were performed: one before the UH-60 Crashworthiness Conference held at USAARL on 19-20 May 1982 and one after the conference. The initial series of tests were performed on Type X-854 webbing, a product of Murdock Webbing Company, Inc., Central Falls, RI. This webbing is the type used in the production model UH-60 Blackhawk. As a result of information communicated during the cited UH-60 conference, the second series of tests included not only the production webbing (Murdock X-854), but also two other webbings for the purpose of comparison: Murdock Q-921 webbing and MIL-W-25361 Type III webbing obtained from Pacific Scientific. All webbings were made of low-elongation polyester-type fiber. The X-854 minimum breaking strength is stated as 6,000 pounds. The Q-921 webbing is an experimental-type that Murdock developed for Pacific Scientific. Murdock stated that it has a breaking strength of 8,740 pounds in pure tension. The MIL-W-25361 Type III webbing is required to have a minimum breaking strength of 7,000 pounds.

The purpose of the first test series was to obtain some production webbing failure load data for the purpose of discussion. Only Murdock X-854 webbing was tested. Basic tensile strength tests were done to establish a basic strength value for comparison. Subsequently, tests were run using the two test fixtures to determine failure loads under potential crash loading geometry. The amount of webbing available was limited, so only a small number of tests could be done. For each sample, the sequence of testing was the following: two straight pulls to determine the basic tensile strength

of the webbing; one test used the combined lateral-longitudinal loading fixture; and two final tests used the longitudinal loading fixture.

For the second series, only basic tensile strength tests and combined lateral-longitudinal loading tests were performed. Because both Pacific Scientific and Sikorsky Aircraft were doing longitudinal loading tests and because there only was a very small amount of the Murdock Q-921 webbing available, the focus at USAARL was on the more severe lateral-longitudinal loading.

## RESULTS AND DISCUSSION

In the first series, the pure tension failure loads for the Murdock X-854 webbing were 6,740 pounds and 7,080 pounds, an average of 6,910 pounds. Loads were applied at the rate of 10 inches per minute. The failure loads for the longitudinal loading using a seat insert guide installed upside down and reversed were 3,320 pounds and 3,010 pounds, an average of 3,165 pounds. That is a 54 percent reduction in average breaking strength when compared to the pure tensile load test. The failure load for the one combined lateral-longitudinal loading test was 2,960 pounds, a 57 percent reduction in breaking relative to that of the pure tensile breaking strength.

The second test series utilized webbing samples obtained from Pacific Scientific. Basic tensile strength tests were done on the MIL-W-25361 Type III and the Murdock X-854 webbing, but not on the Murdock Q-921 webbing due to the limited quantity available. The basic tensile failure loads for the Type III webbing were 8,000 pounds, 8,200 pounds, and 8,300 pounds, an average of 8,167 pounds. The Murdock X-854 basic tensile failure loads were 6,900 pounds, 6,880 pounds, and 7,080 pounds, an average of 6,953 pounds. All the other tests in this series used the combined lateral-longitudinal test fixture. All testing was done at a rate of 10 inches per minute. Three tests were run for each webbing type. The results are shown in Table 1.

TABLE 1  
WEBBING FAILURE LOADS FOR COMBINED LATERAL-LONGITUDINAL LOADING

Webbing Type	1st Test (lb.)	2d Test (lb.)	3d Test (lb.)	Average (lb.)	Reduction from Basic Tensile Strength
MIL-W-25361 Type III	3,350	3,200	3,260	3,270	60%
Murdock X-854	2,800	2,940	2,900	2,730	61%
Murdock Q-921	3,240	3,360	3,360	3,320	62%*

\* Basic tensile strength used was 8,740 lbs. as stated by Murdock Webbing Company, Inc.

Sikorsky and Pacific Scientific notified USAARL of their findings. Sikorsky found the average failure load for Murdock X-854 webbing in pure tension was 6,540 pounds. Pacific Scientific found the average failure load was 6,613 pounds. When pulled through a correctly-installed seat insert guide in a longitudinal loading condition, Sikorsky found that the average failure load for Murdock X-854 webbing was 4,733 pounds while Pacific Scientific tests resulted in an average failure load of 4,883 pounds. The percentage reduction in breaking strength using the correctly-installed seat insert guide was 27.6 percent in Sikorsky's test and 26.2 percent in Pacific Scientific's test.

Both companies also tested the Murdock Q-921 webbing using longitudinal loading through a correctly-installed seat insert guide. The average failure load reported by Sikorsky was 6,250 pounds. The average failure load reported by Pacific Scientific was 6,130 pounds. Using Murdock's tensile strength statement of 8,740 pounds for Q-921, the reduction in tensile strength for Sikorsky's test was 28.5 percent and for Pacific Scientific's test was 29.9 percent.

In all cases a significant reduction in tensile strength was shown when the webbing was forced to change directions by bending over the seat insert guide. The greatest reductions in failure loads were caused by the combined lateral-longitudinal loading and by the incorrect installation of the seat insert guide. The seat insert guide installation problem has been corrected, but the combined lateral-longitudinal loading problem remains as a potential threat.

In an attempt to understand the stress concentration failure mechanism, USAARL contacted several Army, Navy, and Air Force research organizations to determine if any substantive research had been done on the problem. Although several of the individuals contacted said that they were aware of the reduction in failure loads caused by small radius fittings used with webbing, they could not identify any specific research on the problem. One report was found which dealt with the failure loads of high-speed parachute webbing (Williams and Benjamin, 1960, p. 54-56). The report states that dynamic failure loads of parachute webbings were only 60 to 74 percent of the failure loads determined statically. It theorized the cause was the dynamic stress wave effect which caused high localized stresses at the solid mounting points where the stress waves reversed direction. It also stated that it was common practice to design parachute suspension lines and risers using a tensile strength of one-half the static tensile strength. The report did not address stress concentrations caused by bends in the webbing.

An article found in the *Textile Research Journal* (Schoppee and Skelton, 1974) dealt with the effect of bend radius on the tensile failure strength of individual fibers. Although the article's authors' findings cannot be directly applied to woven webbing, the results found for individual fibers may suggest a trend that also will be found in woven webbing. In particular, they presented a curve showing that high tenacity polyester fiber, which is the material used in the restraint harness webbings addressed herein, is sensitive to the radius of curvature around which it is bent. Their data (Figure 6)



show that the breaking strength of the fiber is reduced by approximately 30 percent when pulled around a cylinder with a diameter no more than 10 times the diameter of the fiber. As the diameter of the cylinder gets smaller, the breaking strength of the fiber continues to decrease. When the ratio of the diameter of the fiber to the diameter of the cylinder approaches 1/20 (i.e., 5 percent), the breaking strength is reduced by 50 percent.

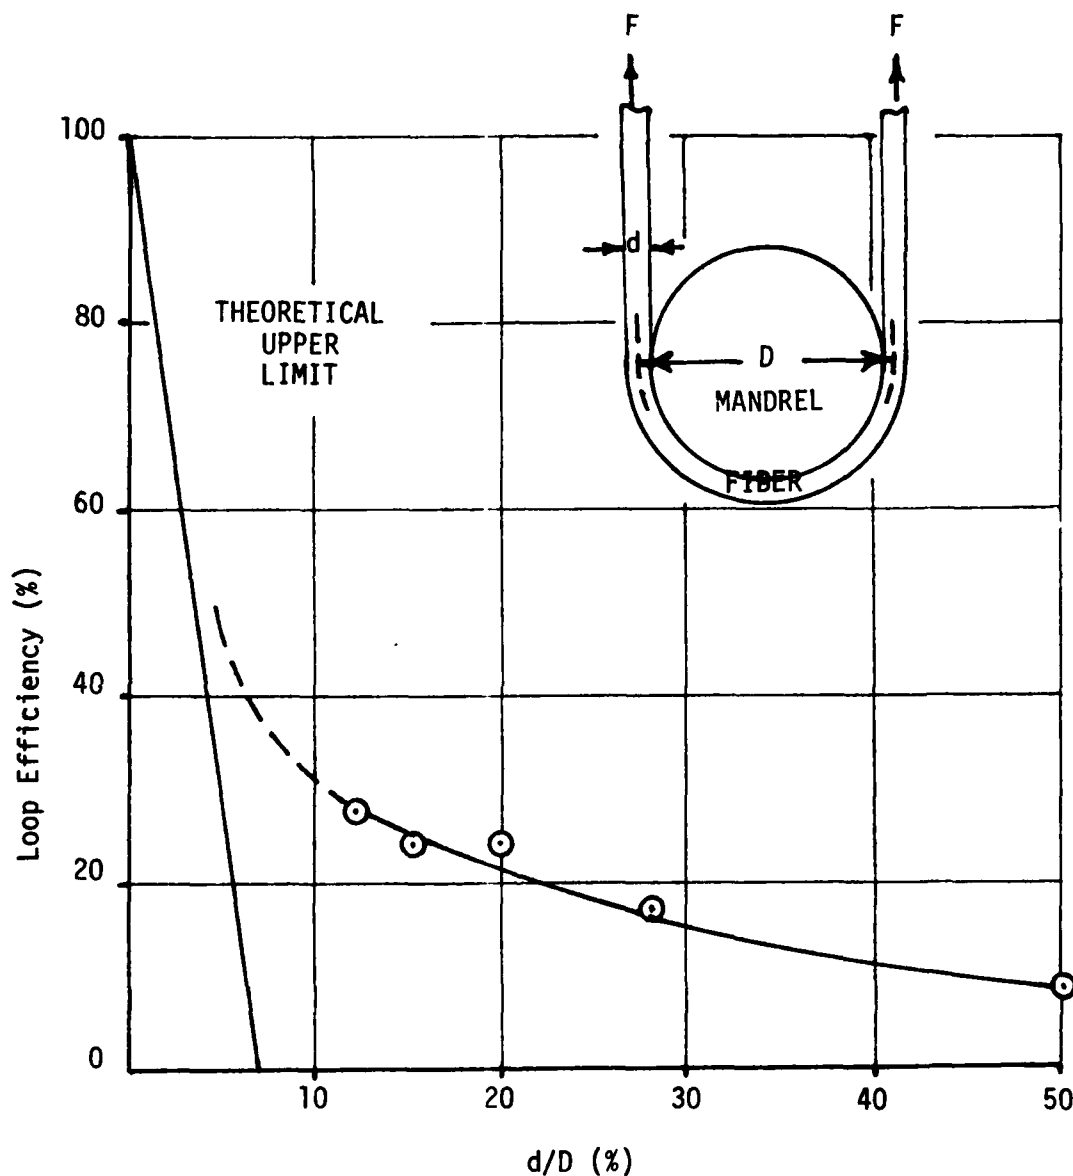


Figure 6. Single Fiber Loop Efficiency for High Tenacity Polyester Fiber (Figure redrawn from Bending limits of some high-modulus fibers, *Textile Research Journal*, Vol. 44, No. 12, Dec 1974, p. 972).

## CONCLUSIONS AND RECOMMENDATIONS

The conclusion of this investigation is that the shoulder harness restraint systems failed at lower than expected loads because of the combination of the incorrect installation of the seat insert guide and the stress concentration caused by the bending of the webbing as it comes up the back of the seat and through the seat insert guide. As a result of the communication of the early findings of this author to the manufacturer, the incorrect installation of the seat insert guides has been corrected. Further research into the effect of bending radius on webbing stress concentration is, however, recommended.

For the interim, the decision by the manufacturer to replace the Murdock X-854 with the higher-strength Q-921 webbing may be an adequate solution. The design load of 4,000 pounds for the shoulder harness initially was given a 50 percent safety factor and is satisfied through the use of 6,000 pound class webbing. In light of the findings to date, a safety factor of 100 percent would appear more reasonable. This can be attained by using 8,000 pound tensile strength webbing.

With the use of increased strength webbing, it may be that the inertia reel itself will prove to be the weakest link in the restraint system. The problem of an inertia reel that is designed for 4,000 pounds already has been partially addressed by the manufacturer. Modifications have been made that increase the strength to 5,000 pounds. However, it may be prudent to investigate the possibility of designing an inertia reel capable of withstanding loads of 8,000 pounds or more.

The importance of proper restraint cannot be overstated. With stronger aircraft frames and seats, the load on restraint harnesses can be expected to increase. Failure of the restraint harness system may become the deciding factor in determining whether or not an aviator survives an accident. Therefore, it may be desirable to over-design in order to build in a high probability of successful performance.

#### REFERENCES CITED

Schoppee, M. S. and Skelton, J. 1974. Bending limits of some high-modulus fibers. *Textile Research Journal*. 44(12):968-975.

Williams, R. B., and Benjamin, R. J. 1960. *Analysis of webbing impact data and determination of optimum instrumentation to be used in conjunction with the impact of webbing*. Wright-Patterson Air Force Base, OH: Wright Air Development Division, Air Research and Development Command. WADC TR 59-694.

## APPENDIX A

### LIST OF MANUFACTURERS CITED

1. Murdock Webbing Company, Inc.  
27 Foundry Street  
Central Falls, Rhode Island 02863
2. Pacific Scientific Company  
Kin-Tech Division  
1346 South State College Boulevard  
Anaheim, California 92803
3. Sikorsky Aircraft  
North Main Street  
Stratford, Connecticut 06602
4. Tinius Olsen Testing Machine Company, Inc.  
Easton Road  
P. O. Box 429  
Willow Grove, Pennsylvania 19090-0429

# INITIAL DISTRIBUTION

Defense Technical Information Center Cameron Station Alexandria, VA 22314	(12)	Aeromechanics Laboratory US Army Research & Technology Lab Ames Research Center, M/S 215-1 Moffett Field, CA 94035	(1)
Under Secretary of Defense for Research and Engineering ATTN: Military Assistant for Medical and Life Sciences Washington, D. C. 20301	(1)	Sixth United States Army ATTN: SMA Presidio of San Francisco California 94129	(1)
Uniformed Services University of the Health Sciences 4301 Jones Bridge Road Bethesda, MD 20014	(1)	Director Army Audiology & Speech Center Walter Reed Army Medical Center Forest Glen Section, Bldg 156 Washington, D.C. 20012	(1)
Commander US Army Medical Research and Development Command ATTN: SGRD-RMS/Ms. Madigan Fort Detrick Frederick, MD 21701	(5)	Harry Diamond Laboratories Scientific & Technical Information Offices 2800 Powder Mill Road Adelphi, MD 20783	(1)
Redstone Scientific Information Center ATTN: DRDMI-TBD US Army Missile R&D Command Redstone Arsenal, AL 35809	(1)	US Army Ordnance Center & School Library, Bldg 3071 ATTN: ATSL-DOSL Aberdeen Proving Ground, MD 21005	(1)
US Army Yuma Proving Ground Technical Library Yuma, AZ 85634	(1)	US Army Environmental Hygiene Agency Library, Bldg E2100 Aberdeen Proving Ground, MD 21010	(1)
US Army Aviation Engineering Flight Activity ATTN: DAVTE-M (Technical Library) Edwards AFB, CA 93523	(1)	Technical Library Chemical Systems Laboratory Aberdeen Proving Ground, Md 21010	(1)
US Army Combat Developments Experimentation Command Technical Library HQ, USACDEC Box 22 Fort Ord, CA 93941	(1)	US Army Materiel Systems Analysis Agency ATTN: Reports Distribution Aberdeen Proving Ground, MD 21005	(1)

Commander US Army Medical Research Institute of Chemical Defense Aberdeen Proving Ground, MD 21010	(1)	US Army Field Artillery School Library Snow Hall, Room 16 Fort Sill, OK 73503	(1)
Commander Naval Air Development Center ATTN: Code 6022 (Mr. Brindle) Warminster, PA 18974		US Army Dugway Proving Ground Technical Library Bldg 5330 Dugway, UT 84022	(1)
Director Ballistic Research Laboratory ATTN: DRDAR-TSB-S (STINFO) Aberdeen Proving Ground, MD 21005	(2)	US Army Material Development & Readiness Command ATTN: DRCSG 5001 Eisenhower Avenue Alexandria, VA 22333	(1)
US Army Research & Development Technical Support Activity Fort Monmouth, NJ 07703	(1)	US Army Foreign Science & Technology Center ATTN: DRXST-IS1 220 7th Street, NE Charlottesville, VA 22901	(1)
Commander/Director US Army Combat Surveillance & Target Acquisition Laboratory ATTN: DELCS-D Fort Monmouth, NJ 07703	(1)	Commander US Army Training & Doctrine Command ATTN: ATCD Fort Monroe, VA 23651	(2)
US Army Avionics R&D Activity ATTN: DAVAA-O Fort Monmouth, NJ 07703		Commander US Army Training & Doctrine Command ATTN: Surgeon Fort Monroe, VA 23651	(1)
US Army White Sands Missile Range Technical Library Division White Sands Missile Range New Mexico 88002	(1)	US Army Research & Technology Labs Structures Laboratory Library NASA Langley Research Center Mail Stop 266 Hampton, VA 23665	(1)
Chief Benet Weapons Laboratory LCWSL, USA ARRADCOM ATTN: DRDAR-LCB-TL Watervliet Arsenal Watervliet, NY 12189	(1)	Commander 10th Medical Laboratory ATTN: DEHE (Audiologist) APO New York 09180	(1)
US Army Research & Technology Labs Propulsion Laboratory MS 77-5 NASA Lewis Research Center Cleveland, OH 44135	(1)	Commander US Army Natick R&D Laboratories ATTN: Technical Librarian Natick, MA 01760	(1)

Commander US Army Troop Support & Aviation Materiel Readiness Command ATTN: DRSTS-W St Louis, MO 63102	(1)	US Air Force Armament Development & Test Center Technical Library Eglin AFB, FL 32542	(1)
Commander US Army Aviation R&D Command ATTN: DRDAV-E 4300 Goodfellow Blvd St. Louis, MO 63166	(1)	US Air Force Institute of Technology (AFIT/LDE) Bldg 640, Area B Wright-Patterson AFB, OH 45433	(1)
Director US Army Human Engineering Laboratory ATTN: Technical Library Aberdeen Proving Ground, MD 21005	(1)	US Air Force Aerospace Medical Division School of Aerospace Medicine Aeromedical Library/TSK-4 Brooks AFB, TX 78235	(1)
Commander US Army Aviation R&D Command ATTN: Library 4300 Goodfellow Blvd St. Louis, MO 63166	(1)	Director of Professional Services Office of the Surgeon General Department of the Air Force Washington, DC 20314	(1)
Commander US Army Health Services Command ATTN: Library Fort Sam Houston, TX 78234	(1)	Human Engineering Division Air Force Aerospace Medical Research Laboratory ATTN: Technical Librarian Wright Patterson AFB, OH 45433	(1)
Commandant US Army Academy of Health Sciences ATTN: Library Fort Sam Houston, TX 78234	(1)	US Navy Naval Weapons Center Technical Library Division Code 2333 China Lake, CA 93555	
Commander US Army Airmobility Laboratory ATTN: Library Fort Eustis, VA 23604	(1)	US Navy Naval Aerospace Medical Institute Library Bldg 1953, Code 012 Pensacola, FL 32508	(1)
Air University Library (AUL/LSE) Maxwell AFB, AL 36112		US Navy Naval Submarine Medical Research Lab Medical Library, Naval Submarine Base Box 900 Groton, CT 06340	(1)
US Air Force Flight Test Center Technical Library, Stop 238 Edwards AFB, CA 93523	(1)	Staff Officer, Aerospace Medicine RAF Staff British Embassy 3100 Massachusetts Avenue, NW Washington, DC 20008	(1)
Colonel Stanley C. Knapp US Central Command CCSG MacDill AFB, FL 33608	(1)		

Director Naval Biosciences Laboratory Naval Supply Center, Bldg 844 Oakland, CA 94625	(1)	Commanding Officer Naval Biodynamics Laboratory P.O. Box 29407 New Orleans, LA 70189	(1)
Naval Air Systems Command Technical Library AIR 9500 RM 278 Jefferson Plaza II Department of the Navy Washington, DC 20361	(1)	FAA Civil Aeromedical Institute ATTN: Library Box 25082 Oklahoma City, OK 73125	(1)
US Navy Naval Research Laboratory Library Code 1433 Washington, DC 20375	(1)	Department of Defence R.A.N. Research Laboratory P.O. Box 706 Darlinghurst, N.S.W. 2010 Australia	(1)
US Navy Naval Air Development Center Technical Information Division Technical Support Department Warminster, PA 18974	(1)	Canadian Society of Avn Med c/o Academy of Medicine, Toronto ATTN: Ms. Carmen King 288 Bloor Street West Toronto, Ontario M5S 1V8 Canada	(1)
Human Factors Engineering Division Aircraft & Crew Systems Technology Directorate Naval Air Development Center Warminster, PA 18974	(1)	COL F. Cadigan DAO-AMLOUS B Box 36, US Embassy FPO New York 09510	(1)
US Navy Naval Research Laboratory Library Shock & Vibration Information Center Code 8404 Washington, DC 20375	(1)	Officer Commanding School of Opnl & Aerospace Medicine DCIEM PO Box 2000 1133 Sheppard Avenue West Downsview, Ontario M3M 3B9 Canada	(1)
Director of Biological & Medical Sciences Division Office of Naval Research 800 N. Quincy Street Arlington, VA 22217	(1)	Dr. E. Hendler Code 6003 Naval Air Development Center Warminster, PA 18974	(1)
Commanding Officer Naval Medical R&D Command National Naval Medical Center Bethesda, MD 20014	(1)	Commander US Army Transportation School ATTN: ATSP-TD-ST Fort Eustis, VA 23604	(1)
Commander Naval Air Development Center Biophysics Laboratory ATTN: George Kydd Code 60B1 Warminster, PA 18974	(1)	National Defence Headquarters 101 Colonel By Drive Ottawa, Ontario K1A 0K2 Canada ATTN: DPM	(1)



Commanding Officer  
404 Maritime Training Squadron  
Canadian Forces Base, Greenwood  
Greenwood, NS BOP 1N0  
Canada

ATTN: Aeromed Training Unit  
WO P. Handy or Capt  
S. Olsen (1)

Canadian Forces Medical Liaison  
Officer  
Canadian Defence Liaison Staff  
2450 Massachusetts Ave, NW  
Washington, DC 20008 (1)

Canadian Airline Pilot's Assn  
Maj. J. Soutendam (Ret)  
1300 Steeles Avenue East  
Brampton, Ontario L6T 1A2  
Canada (1)

